


CALIBRATING YOUR NOTE BANDS

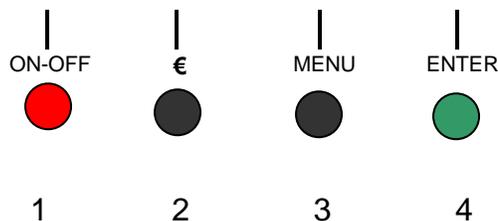

GUIDE TO CALIBRATING BANDS

1. Whilst in the normal counting mode, press the **MENU** key. This takes you to the “**Menu**” screen.
2. “**Options**”, is highlighted, press the **ENTER** key. This takes you to the “**Options**” screen.
3. Again, using the **NOTES** key, select “**Supervisor**” (option 6), then press **ENTER**. This takes you to the “**PIN Number**” screen.
4. When Tellermate asks for a PIN number, using the Tellermate “soft” keys (see diagram above), key in:
1 (ON-OFF) 4 (ENTER) 2 (€) 4 (ENTER). This takes you to the “**Supervisor**” screen.
5. As Setup/Calibrate is highlighted, press **ENTER**.
6. As “**NOTES**” is highlighted, press **ENTER**. You will now be in the “**Press WRAP for Setup**” screen.
7. Highlight the denomination for which you wish to calibrate the band. Press the **WRAP** key **TWICE**. You will be taken to the ‘**Calibrate band 1**’ screen. Then press **ENTER**. You will be asked to put 5 bands on the hod. Place 5 empty bands on the hod.
8. Tellermate will now come up with the message ‘**Done – Calibration complete**’ and then ‘**Please clear hod of all cash/cups**’. Once you have done this, it will then take you back to the “**Press WRAP for Setup**” screen.
9. If you wish to calibrate more bands go back to stage 7.
10. ***When you have calibrated all the required bands, press END repeatedly until you return to normal counting mode.***